


TEKTON®

Model #
24320

TORQUE WRENCH OPERATOR'S MANUAL

STORE THIS MANUAL IN A SAFE
PLACE FOR FUTURE REFERENCE

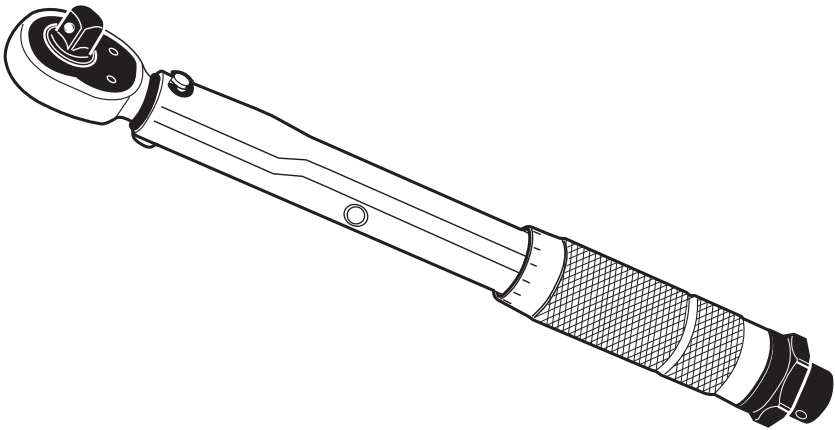

NEED HELP?

888-648-3371
support@tekton.com



Please read and understand entire manual, including all safety information, before using torque wrench. This tool is a precision measuring instrument. Handle with care and store properly. Do not attempt to increase leverage of this wrench with any other device. Failure to follow all instructions could result in damage to torque wrench, property damage, or injury.

- At low torque settings, pull wrench slowly to observe click.
- Wrench is shipped ready to use, calibrated and tested to an accuracy of +/- 4%. To maintain this accuracy, it is important that wrench is stored at lowest torque setting, 20 in.-lb (2.2 Nm). This setting relieves extra tension on the internal spring, reducing fatigue that can adversely affect accuracy.

SETTING TORQUE READING

This is a dual-range torque wrench marked with inch pounds (in.-lb.) and Newton meters (Nm) on opposite sides of handle.

The torque scale is marked on the handle body with more precise subdivisions on the knurled handle (Fig. A). In these instructions the handle body scale will be referred to as the "main scale" and the knurled handle scale will be referred to as the "micrometer scale".

⚠ Tighten/adjust lock nut and knurled handle by hand only.




Inch Pounds (Example reading: 119 in.-lb.)

1. Locate lock nut on the end of handle. Unlock knurled handle by turning lock nut counterclockwise.
2. **COARSE SCALE ADJUSTMENT (Fig. B):** Using in.-lb. scale, turn knurled handle until its top edge is even with the horizontal "110" mark on main scale and the "0" mark on micrometer scale is centered on vertical line of main scale.
3. **FINE SCALE ADJUSTMENT (Fig. C):** The micrometer scale divides the main scale markings into 15 divisions. Every micrometer scale marking equals 1 in.-lb., also known as the minimum increment. To increase torque from 110 to 119, turn micrometer handle clockwise until "9" mark is centered on vertical line of main scale. 110 in.-lb. (main scale) + 9 in.-lb. (micrometer scale) = 119 in.-lb.
4. Lock torque setting by turning lock nut clockwise until snug. Wrench is now set to measure 119 in.-lb. of torque and ready to use.

Newton Meters (Example reading: 10.0 Nm)

Setting desired torque on the Nm scale uses the same procedure described above for in.-lb. scale. The micrometer scale divides the main scale markings into 15 divisions. Every micrometer scale marking equals 0.11 Nm, also known as the minimum increment.


To set a torque value of 10.0 Nm, turn knurled micrometer handle until top is aligned with "9.0" mark on main scale and the "0" mark on micrometer scale is centered on vertical line of main scale. To increase torque from 9.0 Nm to 10.0 Nm, turn micrometer handle clockwise until the "9" mark is centered on vertical line of main scale. 10.0 Nm - 9.0 Nm = 1.0 Nm. 1.0 Nm ÷ 0.11 = 9 micrometer scale markings. Wrench is now set to measure 10.0 Nm of torque and ready to use.

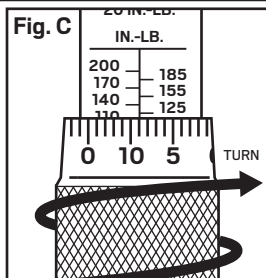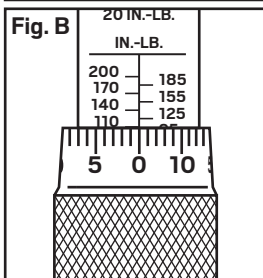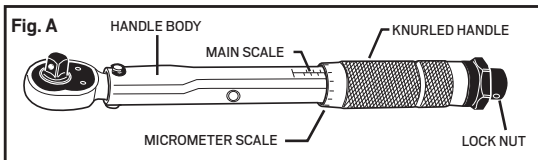

WRENCH OPERATION


Fig. D illustrates the basic operation of the torque wrench. For accurate operation, grasp the knurled handle only and apply pulling force. When the desired torque setting is reached, the roller bearing and roller pin will roll over each other, causing a click you can hear and feel. NOTE: At low torque settings, click can be subtle. Use wrench in a quiet environment.

1. Install proper socket/attachment to square drive. Place socket on nut/bolt to be tightened.
2. Operate torque wrench the same as a standard socket wrench to tighten nut/bolt. As nut/bolt becomes snug, slow operation to a smooth, steady pull. Operating wrench too quickly or with too much force may cause you to miss the exact torque setting. At the instant the wrench clicks, torque setting has been reached. Stop pulling wrench and release pressure on handle. Do not continue to pull after torque setting is reached. Doing so will overtighten the nut/bolt and could damage wrench. Once pressure is released from the handle, wrench will automatically reset for next operation. NOTE: At low torque settings, use extra care to release wrench at the proper point after it clicks.
3. Wrench does not measure torque below 20 in.-lb. (2.2 Nm).
4. Do not use wrench to break free stuck fasteners.

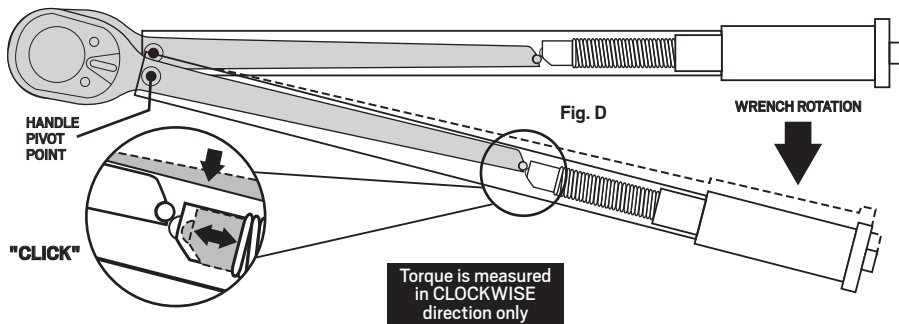

MAINTENANCE AND STORAGE

1. If wrench has not been used for a long period of time, operate it several times at a low torque setting. This will allow internal lubricant to recoat moving parts.
2. When wrench is not in use, keep adjustment at lowest torque setting, 20 in.-lb. (2.2 Nm) (Fig. E). Do not turn handle below lowest torque setting.
3. This wrench is a precision measuring instrument. Take care to operate wrench correctly. Store in a clean, dry environment.
4. Clean wrench by wiping with a clean, dry, lint-free cloth. Do not immerse in any type of liquid or cleaner. This may damage the internal components of the wrench.

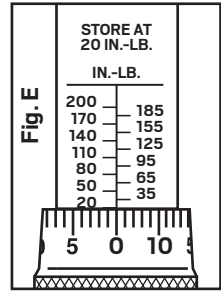


TORQUE UNIT CONVERSION TABLE

INCH POUNDS (in.-lb.)	FOOT POUNDS (ft.-lb.)	NEWTON METERS (Nm)	FOOT POUNDS (ft.-lb.)	INCH POUNDS (in.-lb.)	NEWTON METERS (Nm)	NEWTON METERS (Nm)	INCH POUNDS (in.-lb.)	FOOT POUNDS (ft.-lb.)
20	1.67	2.26	1	12	1.35	2	17.70	1.47
25	2.08	2.82	2	24	2.71	3	26.55	2.21
30	2.50	3.39	3	36	4.06	4	35.40	2.95
35	2.92	3.95	4	48	5.42	5	44.25	3.68
40	3.33	4.52	5	60	6.78	6	53.10	4.42
45	3.75	5.08	6	72	8.13	7	61.95	5.16
50	4.17	5.65	7	84	9.49	8	70.80	5.90
55	4.58	6.21	8	96	10.84	9	79.65	6.63
60	5.00	6.78	9	108	12.20	10	88.50	7.37
65	5.42	7.34	10	120	13.55	11	97.35	8.11
70	5.83	7.91	11	132	14.91	12	106.20	8.85
75	6.25	8.47	12	144	16.27	13	115.06	9.58
80	6.67	9.03	13	156	17.62	14	123.91	10.32
85	7.08	9.60	14	168	18.98	15	132.76	11.06
90	7.50	10.16	15	180	20.33	16	141.61	11.80
95	7.91	10.73	16	192	21.69	17	150.46	12.53
100	8.33	11.29	17	204	23.04	18	159.31	13.27
105	8.75	11.86	18	216	24.40	19	168.16	14.01
110	9.17	12.42	19	228	25.76	20	177.01	14.75
115	9.58	12.99	20	240	27.11	21	185.86	15.49
120	10.00	13.55	21	252	28.47	22	194.71	16.22
125	10.42	14.12	22	264	29.82	23	203.56	16.96
130	10.83	14.68						
135	11.25	15.25						
140	11.67	15.81						
145	12.08	16.38						
150	12.50	16.94						
155	12.91	17.51						
160	13.33	18.07						
165	13.75	18.64						
170	14.17	19.20						
175	14.58	19.77						
180	15.00	20.34						
185	15.42	20.90						
190	15.83	21.46						
195	16.25	22.03						
200	16.67	22.59						

CONVERSIONS		
1 in.-lb. =	1 ft.-lb. =	1 Nm =
0.0833 ft.-lb.	0.138 m-kg	0.737 ft.-lb.
0.113 Nm	12.0 in.-lb.	8.85 in.-lb.
0.0115 m-kg	1.35 Nm	0.102 m-kg
1.15 cm-kg	13.8 cm-kg	10.2 cm-kg

NOTE: Exploded view diagram provided for illustration purposes only. Do not disassemble any part of torque wrench. There are no user serviceable parts on or inside wrench. Parts shown and assembly may differ slightly based on model.

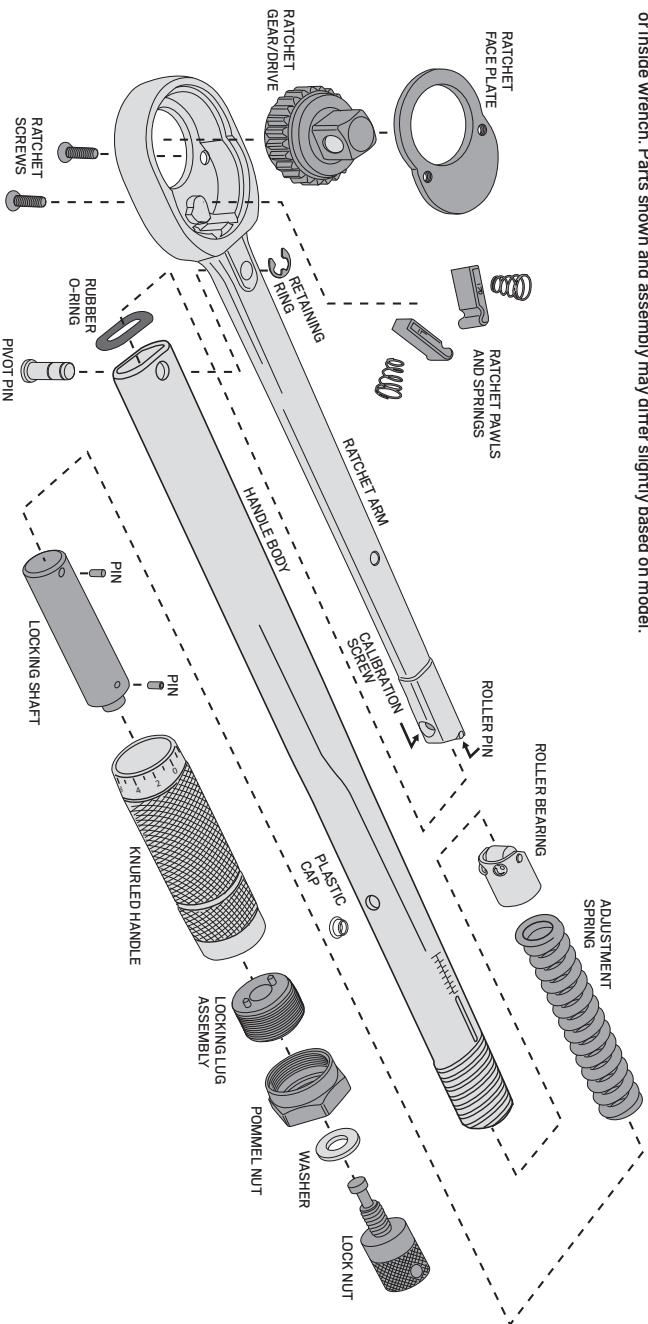

TEKTON®
 3701 Royal Drive, Office 5F
 Grand Prairie, TX 75050
 Made in Taiwan

© 2017
TEKTON.COM

Drive	1/4 in.
Ratchet	24 Tooth
Length	12 in.
Dual Range	20 - 200 in.-lb. and 2.2 - 22.6 Nm
Increment	1 in.-lb. (0.11 Nm)
Accuracy	+/- 4%